



Applies To: 1997 Prelude – Type SH

April 21, 1997

ATTS Heat Shield Rattle or Buzzing

SYMPTOM

A rattle or buzzing noise from under the vehicle when accelerating from 3500 to 5200 rpm.

PROBABLE CAUSE

Insufficient clearance between the Active Torque Transfer System (ATTS) unit and the heat shield.

CORRECTIVE ACTION

Increase the clearance between the ATTS unit and the heat shield with the washer listed under PARTS INFORMATION.

PARTS INFORMATION

Washer (one required):

P/N 94101-06700, H/C 0294231

WARRANTY CLAIM INFORMATION


In warranty: The normal warranty applies.

Operation number: 219323
Flat rate time: 0.3 hour
Failed part: P/N 41181-P6K-010
H/C 5303797
Defect code: 043
Contention code: B07
Template ID: 97-037A

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Raise the vehicle on a hoist.
2. Loosen the two left mounting bolts, and remove the right mounting bolt on the ATTS unit heat shield.

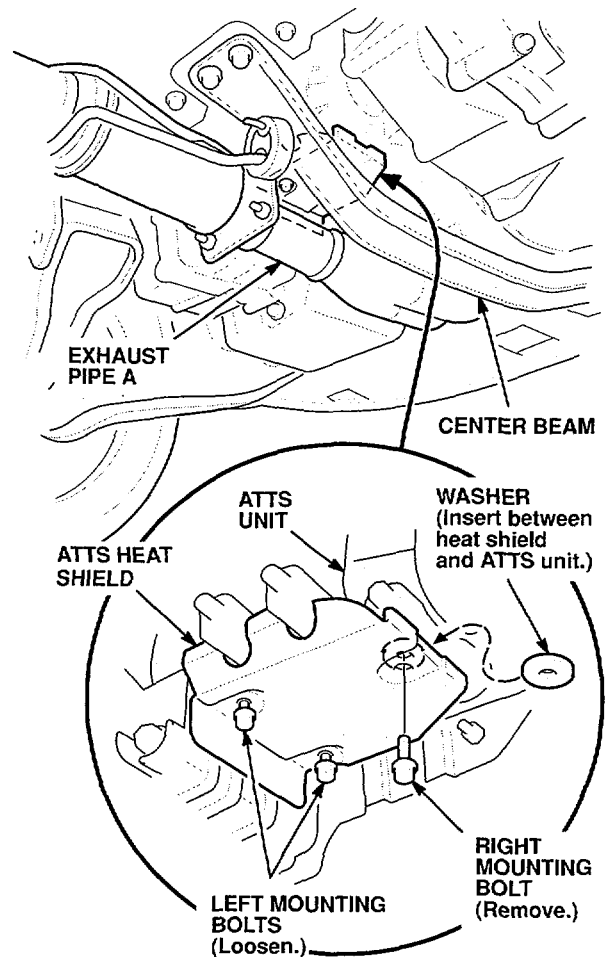

3. Insert the washer between the ATTS unit and the heat shield, then reinstall the right mounting bolt.
4. Torque all three mounting bolts to 9.8 N-m (7 lb-ft).

046806

046806